

KUSSO TWO DEPARTURE (RNAV)
(KUSSO2.KUSSO) 22JAN26

LONE STAR DEP CON
135.975 379.9
CTAF
123.0



RNAV 1 - DME/DME/IRU or GPS.
RADAR required.

**TOP ALTITUDE:
ASSIGNED BY ATC**

TAKEOFF MINIMUMS

Rwy 35: Standard.

Rwy 17: 300-2 or standard with minimum
climb of 512' per NM to 1300.

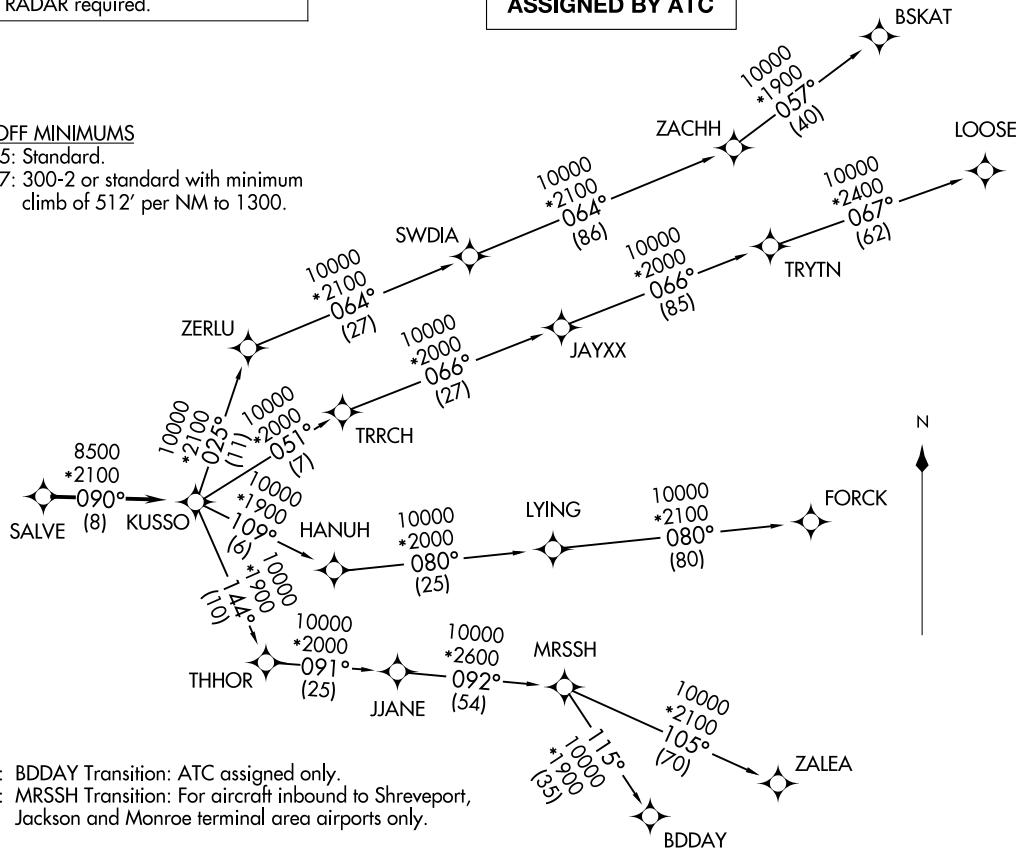

NOTE: BDDAY Transition: ATC assigned only.

NOTE: MRSSH Transition: For aircraft inbound to Shreveport,
Jackson and Monroe terminal area airports only.

(CONTINUED ON FOLLOWING PAGE)


NOTE: Chart not to scale.

(KUSSO2.KUSSO) 26022
KUSSO TWO DEPARTURE (RNAV)

AL-6854 (FAA)

BOURLAND FLD (50°F)
FORT WORTH, TEXAS

PORT WORTH, TEXAS
BOURLAND FLD (50°F)

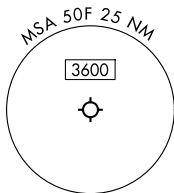

▼

DEPARTURE ROUTE DESCRIPTION

TAKEOFF RUNWAY 17: Climb on heading 171° to 1400 before turning right.

When entering controlled airspace, fly heading assigned by ATC, expect vector to SALVE, then on track 090° to KUSSO, then on assigned transition. Maintain ATC assigned altitude, expect filed altitude 10 minutes after departure.

- BDDAY TRANSITION (KUSSO2.BDDAY)
BSKAT TRANSITION (KUSSO2.BSKAT)
FORCK TRANSITION (KUSSO2.FORCK)
LOOSE TRANSITION (KUSSO2.LOOSE)
MRSSH TRANSITION (KUSSO2.MRSSH)
ZALEA TRANSITION (KUSSO2.ZALEA)

SC-2, 19 FEB 2026 to 19 MAR 2026

SC-2, 19 FEB 2026 to 19 MAR 2026